The Department of Ecology does NOT Warranty the Data and/or the Information on this Well Report.

Well tag id: AGA764

STATE OF WASHINGTON
DEPARTMENT OF CONSERVATION AND DEVELOPMENT

WELL LOG

No. Appli. #5880
Cert 4594

Date 5-8, 1961.

Record by well driller

Source driller's record

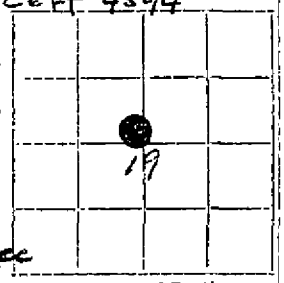

Diagram of Section

Location: State of WASHINGTON

County Island

Area

Map 330'W & 30'N of Center of Sec

SE¼SE ¼ NW ¼ sec 19 T 32 N., R 3 E.

Drilling Co. A. G. Kaunkel

Address Box 216, Stanwood, Wash.

Method of Drilling Date 9-6, 1960

Owner Buena Vista Community Club

Address Rt. 1, Box 156, Camano Island, Wn.

Land surface, datum 230 ft. above / below
Quad

32/3E.19F
File number

CORRELATION	MATERIAL	THICKNESS (feet)	DEPTH (feet)
	(Transcribe driller's terminology literally but paraphrase as necessary, in parentheses. If material water-bearing, so state and record static level if reported. Give depths in feet below land-surface datum unless otherwise indicated. Correlate with stratigraphic column, if feasible. Following log of materials, list all casings, perforations, screens, etc.)		
	Hardpan	72	72
	Fine sand	93	165
	Coarse sand	7	172
	Blue clay	11	183
	Sand & gravel	32	215
	Hard yellow clay	1	216
	Fine sand & water	39	255
	Coarse " " "	18	273
	PUMP TEST:		
	Dim. 273'x 6"		
	SWL: 215'		
	DD: 4½'		
	Yield: 45 g.p.m.		
	Water Temp. 49°		
	CASING:		
	6" diam. from 0 to 273 ft.		
	PERFORATIONS:		
	#40 wire wound screen from 263 to 273'		

Turn up

Sheet ..... of ..... sheets

Department of Ecology does NOT Warranty the Data and/or the Information on this Well Report.

STATE OF WASHINGTON
DEPARTMENT OF CONSERVATION
AND DEVELOPMENT

WELL LOG

No. Appli. #5880
Cert 4544

Date 5-8, 1961.

Record by well driller

Source driller's record

Location: State of WASHINGTON

County Island

Area

Map 330'W & 30'N of Center of Sec

SE¼SE ¼ NW ¼ sec 19 T. 32 N., R. 3 E. ~~W~~

Diagram of Section

Drilling Co. A. G. Kaunkel

Address Box 216, Stanwood, Wash.

Method of Drilling Date 9-6, 1960

Owner Buena Vista Community Club

Address Rt. 1, Box 156, Camano Island, Wn.

Land surface, datum 230 ft. above below
Quad

Correlation	Material	Thickness (feet)	Depth (feet)
	Hardpan	72	72
	Fine sand	93	165
	Coarse sand	7	172
	Blue clay	11	183
	Sand & gravel	32	215
	Hard yellow clay	1	216
	Fine sand & water	39	255
	Coarse " " "	18	273
	PUMP TEST:		
	Dim. 273'x 6"		
	SWL: 215'		
	DD: 4½'		
	Yield: 45 g.p.m.		
	Water Temp. 49°		
	CASING:		
	6" diam. from 0 to 273 ft.		
	PERFORATIONS:		
	#40 wire wound screen from 263 to 273'		

(Transcribe driller's terminology literally but paraphrase as necessary, in parentheses. If material water-bearing, so state and record static level if reported. Give depths in feet below land-surface datum unless otherwise indicated. Correlate with stratigraphic column, if feasible. Following log of materials, list all casings, perforations, screens, etc.)

Turn up

Sheet ..... of ..... sheets

File number 32/3E-19F